



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

HolyMess Repairs – Forensic Structural Roof Assessment & Rectification Quotation

Job Reference: JN 6222 – Vermont South Roof Leak Repair & Full Maintenance

Date: Sunday, 17 May 2026

Prepared by: Victor C, Compliance Manager

Licence No.: 32176 (HolyMess Repairs)

ABN: 31 666 327 813

Contact: 0426 204 244 | info@holymessrepairs.com.au

Addresses: Unit 10, 236-244 Edwardes Rd, Reservoir VIC & 19 Chivers Rd, Templestowe VIC

Website: <https://www.holymessrepairs.com.au/>

Facebook: <https://www.facebook.com/holymessrepairs.com.au>

YouTube Company Video: <https://youtu.be/4GoaRAOMo2o>

Promotional Video: <https://youtu.be/6YKaP0SJDf0>

Google Reviews: <https://g.co/kgs/ezuh8bk>

Client:

[REDACTED]

[REDACTED]

[REDACTED] Vermont South VIC 3133

Phone: [REDACTED]

Property:

[REDACTED] Vermont South VIC 3133

(Approximately 50-year-old concrete-tiled roof, cosmetically restored approximately 20 years ago; five-bedroom residence on approximately 678 m² land, City of Whitehorse local government area, estimated market value approximately \$1.80 million AUD)

[REDACTED]

Thank you for your call on Tuesday and for authorising the non-destructive hydrostatic roof dye test at a cost of \$1,400 plus GST, which you have fully paid. The dye test precisely mapped the water migration paths causing the active ceiling leak by the front door and confirmed the heavily choked gutters as a secondary contributor. This Forensic Structural Roof Assessment and Rectification Quotation is based on the on-roof inspection, dye-test results, and high-resolution photographic and videographic evidence.

All proposed works fully comply with Victorian Building Authority guidelines, Australian Standard AS 2050 (Installation of Roof Tiles), AS 3500.3 (Stormwater Drainage), AS 1684 (Residential Timber-Framed Construction), WorkSafe Victoria, and EPA Victoria regulations.



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32178 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Full Digital Archive

Google Drive folder containing all high-resolution photographs and videographic records from the forensic site assessment:

All Site Photos (posted as permanent public evidence – click each link to view):

<https://x.com/victorchandra09/status/2055619085703286963?s=20>
<https://x.com/victorchandra09/status/2055618996024852600?s=20>
<https://x.com/victorchandra09/status/2055618703790903621?s=20>
<https://x.com/victorchandra09/status/2055618592797040671?s=20>
<https://x.com/victorchandra09/status/2055618466795880601?s=20>
<https://x.com/victorchandra09/status/2055618365356683409?s=20>
<https://x.com/victorchandra09/status/2055618241305944159?s=20>
<https://x.com/victorchandra09/status/2055618098426954091?s=20>
<https://x.com/victorchandra09/status/2055617991321199021?s=20>
<https://x.com/victorchandra09/status/2055617910509560158?s=20>
<https://x.com/victorchandra09/status/2055617802334302520?s=20>

<https://x.com/victorchandra09/status/2055617718641209377?s=20>

Technical Analysis of Visual Evidence

Every image was captured during the roof inspection and dye test. The analysis below identifies the structural anomalies, failure mechanisms, and how each piece of evidence justifies the rectification options.

- <https://x.com/victorchandra09/status/2055619085703286963?s=20> and <https://x.com/victorchandra09/status/2055618996024852600?s=20> (**Visual Assets 1 & 2 – Garage eave**): These images show heavy water staining, swelling, localised rot, sagging fiber-cement eave sheets, and open joints on the approximately 3 m garage side section caused by chronic gutter overflow. This confirms the eave lining cannot be patched and must be structurally replaced, directly justifying Option 1.
- <https://x.com/victorchandra09/status/2055618592797040671?s=20> (**Visual Assets 3 & 4 – Skylight**): These images display severe yellowing, micro-fracturing, embrittlement of the hollow-core plastic glazing, corroded and loose aluminum pop rivets, and completely desiccated sealant. Water is weeping through fastener penetrations, justifying Option 2 (upgrade to solid impact-resistant Perspex with proper sealing).
- <https://x.com/victorchandra09/status/2055618466795880601?s=20>, <https://x.com/victorchandra09/status/2055618365356683409?s=20>,



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

<https://x.com/victorchandra09/status/2055618703790903621?s=20> and

<https://x.com/victorchandra09/status/2055618241305944159?s=20> (Visual Assets

5–8 – Tiles & ridges): These images document slipped and fractured concrete roof tiles near the front-door leak path, crumbling ridge-cap bedding mortar, complete loss of mortar on corner hips, and severely fractured flexible pointing. These are the primary vectors of the ceiling breach, justifying Option 3.

- <https://x.com/victorchandra09/status/2055618241305944159?s=20>,
<https://x.com/victorchandra09/status/2055618098426954091?s=20>,
<https://x.com/victorchandra09/status/2055617991321199021?s=20> and
<https://x.com/victorchandra09/status/2055617718641209377?s=20> (Visual Assets **9 & 10 – Biological & drainage**): These images reveal intensive moss and lichen colonisation across the tile field and heavily choked gutter channels filled with decomposed leaf matter, silt, and weed growth. This justifies Option 4 (high-pressure clean).
- **Systemic overview images across all posts (Visual Asset 11)**: These show widespread loss of tile glaze, patchy historical repairs, and overall decay of the 50-year-old concrete tile matrix. Spot repairs are temporary; comprehensive Options 5 and 6 provide the permanent systemic solution.

Recommended Rectification Options (all prices include GST)

Any extra work discovered on-site will be notified to you immediately with fresh photos/video and a written variation quote before proceeding. All work is carried out by licensed roofers under Licence 32176 and includes full photographic evidence, compliance certificates, and post-work verification. Realistic timelines are based on a professional three-person team: two Registered Roof Technicians and one dedicated Site Supervisor/Quality Control Officer, including all real-world downtime factors (safety setup, weather checks, material curing, tool changes, lunch breaks, site sign-in, health and safety briefings).

Option 1: Garage Eave Lining Replacement (~3 m lateral section) – \$1,716 including GST (7-year structural/workmanship warranty) – Realistic duration: 1.5 days

Option 2: Skylight Perspex Retrofitting – \$786.50 including GST (5-year watertightness warranty) – Realistic duration: 0.5 days

Option 3: Change Broken Tiles + Ridge Rebedding (Where Required, Mainly Corners as They Are Completely Broken) & Full Repointing of the Whole House – \$5,148 including GST (10-year structural integrity warranty) – Realistic duration: 3 days

Option 4: High-Pressure Roof & Gutter Clean – \$2,145 including GST (2-year biological regrowth resistance warranty) – Realistic duration: 1 day



Option 5: Comprehensive Structural Repair & Deep Clean Package – \$12,155 including GST (10-year combined structural & watertightness warranty) – Realistic duration: 4–5 working days

Option 6: Ultimate Premium Whole Roof Restoration – \$22,440 including GST (12-year full-system watertightness & material warranty) – Realistic duration: 10–11 working days (strongly recommended for your \$1.80 million asset)

OPTION 1: Garage Eave Lining Replacement (~3 m lateral section) – \$1,716 including GST (7-year structural/workmanship warranty) – Realistic duration: 1.5 days (2 technicians + 1 supervisor, total ~24 technician hours + 12 supervisor hours including all downtime)

Material & Tooling Matrix

- Two premium external-grade 4.5 mm fiber-cement eave sheets
- One heavy-duty PVC H-profile joining strip
- Box of hot-dip galvanized clout nails
- Two lengths of structural H3-treated pine timber battens
- Sikaflex-11FC polyurethane sealant, paintable exterior primer-sealer, Dulux Weathershield low-sheen paint
- Tools: Safety harness system, circular saw with diamond-tipped fiber-cement blade, dust-shrouded HEPA vacuum, claw hammer, pry bar, hand saw, caulking gun, chalk line, paint roller/brushes, level, tape measure

Diagram 1: Explaining the Job – Cross-Section of Garage Eave Lining Replacement



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

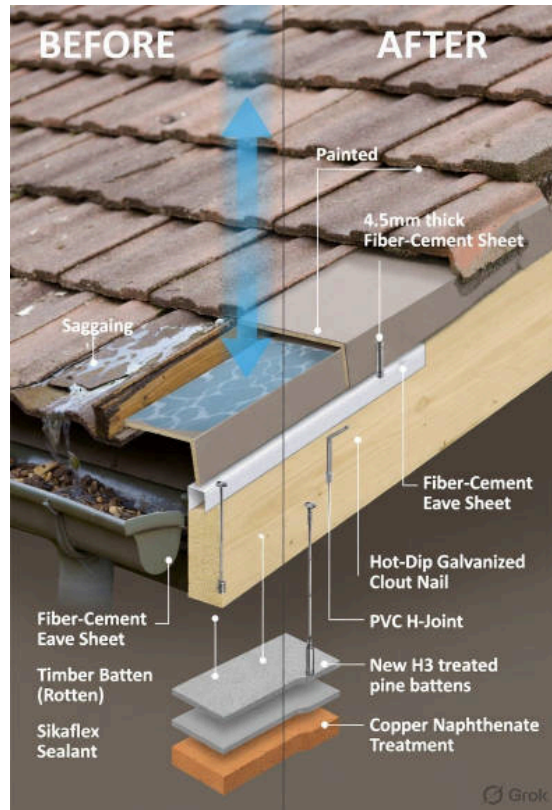


Diagram 2: Showing the Outcome – Before vs After Eave Repair



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073



Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Establish a clear exclusion zone at ground level. *What could go wrong:* Falls from height leading to injury. *Mitigation:* Certified anchors, full-body harnesses, daily inspections, two-person rule, AI safety checklist, supervisor verification. Other tradespeople sometimes skip proper harness systems; HolyMess never does this because we have the largest vetted tradesperson network and agentic AI project management to enforce every safety protocol.
2. **Controlled Demolition** – Wear P2 respirator and safety goggles. Use pry bar and claw hammer to extract rusted nails and remove damaged eave lining in sections. Lower debris and place directly into industrial waste bags. *What could go wrong:* Uncontrolled collapse or sharp debris causing injury or damaging garden/ceiling. *Mitigation:* Remove in controlled sections, protective mats, immediate bagging.
3. **Structural Inspection & Timber Preservation** – Vacuum all organic debris and dust from the exposed roof cavity. Inspect rafter tails and wall-plate battens with a wood moisture meter (must be below 15%). Apply generous coat of copper naphthenate preservative. If minor rot is present, scrape back to solid timber and sister new H3-treated pine batten with structural screws. *What could go wrong:* Trapping active



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

wood rot leading to future structural failure. *Mitigation:* Scrape to sound timber, full treatment, photographic documentation.

4. **Framing Realignment & Sheet Fabrication** – Use spirit level to check alignment and install additional pine supports where needed. Measure the structural opening and cut fiber-cement sheets outdoors with dust-shrouded saw and wet-mist suppression. *What could go wrong:* Incorrect measurements or silica dust exposure causing health issues. *Mitigation:* Double-measure on site, P2 respirators, dedicated vacuum attachment.
5. **Sheet Installation & Joint Integration** – Offer first sheet into wall groove, secure front edge with clout nails at maximum 150 mm centres. Slide PVC H-profile joining strip onto end, position second sheet with 5 mm expansion gap, nail securely. Apply continuous smooth bead of Sikaflex-11FC along all junctions and tool to water-shedding bevel. *What could go wrong:* Poor seal leading to future leaks. *Mitigation:* Mechanical fix plus silicone, post-install water test.
6. **Painting, Cleanup & QC** – Apply one coat of primer-sealer followed by two coats of UV-resistant low-sheen paint colour-matched to existing trim. Vacuum surrounding ground area. Supervisor performs final inspection with before/after photos. *What could go wrong:* Incomplete cleanup or missed defects. *Mitigation:* Full supervisor QC, photographic evidence.

OPTION 2: Skylight Perspex Retrofitting – \$786.50 including GST (5-year watertightness warranty) – Realistic duration: 0.5 days (1 technician + 1 supervisor)

Material & Tooling Matrix

- One 4.5 mm thick high-impact UV-stabilized clear solid Perspex sheet
 - Thirty structural aluminum pop rivets with wide flange head
 - Thirty vulcanized EPDM-backed aluminum sealing washers
 - One tube of neutral-cure structural silicone sealant (Selleys Roof & Gutter or equivalent)
 - Isopropyl alcohol solvent and lint-free cleaning cloths
- Tools: Safety harness system, crawling boards/foam tile pads, variable-speed cordless drill, cobalt metal drill bit, plastic-drilling bit, hand-held rivet gun, steel scraper, wire brush, caulking gun, glass-cutter



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Diagram 1: Explaining the Job – Skylight Perspex Retrofitting Cross-Section



Diagram 2: Showing the Outcome – Before vs After Skylight Repair



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073



Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Lay foam tile pads or crawling boards on tiles adjacent to skylight. *What could go wrong:* Falls or cracked tiles from foot traffic. *Mitigation:* Certified anchors, weight-distributing pads, supervisor oversight.
2. **Fastener Removal** – Use cordless drill with cobalt bit at low speed to drill out old corroded pop rivets. *What could go wrong:* Enlarging rivet holes in aluminum frame. *Mitigation:* Low-speed controlled drilling.
3. **Disassembly & Frame Cleaning** – Carefully lift away old plastic sheet. Scrape and wire-brush all old silicone, dirt, and corrosion. Clean frame with isopropyl alcohol. *What could go wrong:* Damage to frame or residual contaminants causing poor adhesion. *Mitigation:* Careful lifting and thorough grease-free cleaning.
4. **Thermal Expansion Calculation & Perspex Fabrication** – Calculate required expansion gap using $\Delta L = L \times 7.2 \times 10^{-5} \times 50\text{ }^{\circ}\text{C}$ (minimum 5 mm around perimeter). Cut Perspex sheet to frame dimensions minus clearance, keeping protective film intact. *What could go wrong:* Buckling or warping in summer heat. *Mitigation:* Precise mathematical modeling and clearance.



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

5. **Pre-Drilling, Sealant Application & Mechanical Fastening** – Pre-drill 4.5 mm holes in Perspex. Apply continuous 5 mm bead of neutral-cure silicone. Press sheet into sealant, insert rivets with EPDM washers, secure with rivet gun (monitor tension). Inject silicone into each rivet hole. *What could go wrong:* Cracking Perspex or water leaks through fasteners. *Mitigation:* Sharp plastic bit, wide-flange washers, proper tension.
6. **Perimeter Sealing, Inspection & Cleanup** – Apply final fillet bead and tool smooth. Peel protective film, check watertight seal. Supervisor QC with photos. *What could go wrong:* Incomplete seal. *Mitigation:* Full perimeter verification and documentation.

OPTION 3: Change Broken Tiles + Ridge Rebedding (Where Required, Mainly Corners as They Are Completely Broken) & Full Repointing of the Whole House – \$5,148 including GST (10-year structural integrity warranty) – Realistic duration: 3 days (2 technicians + 1 supervisor)

Material & Tooling Matrix

- Colour/profile-matched concrete roof tiles
- General-purpose Portland cement and clean washed bricklayer's sand
- SBR latex polymer bonding additive
- Flexipoint acrylic flexible pointing compound (charcoal colour-matched)
- Galvanized concrete tile clips

- Tools: Dust-shrouded angle grinder with diamond tuckpoint blade, M-class HEPA vacuum, mechanical mortar mixer, plasterer's trowel, pointing trowel, jointing tool, brick-wetting brush, string line, tile-lifter

Diagram 1: Explaining the Job – Ridge Rebedding & Repointing Process



HolyMess Pty. Ltd.

Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

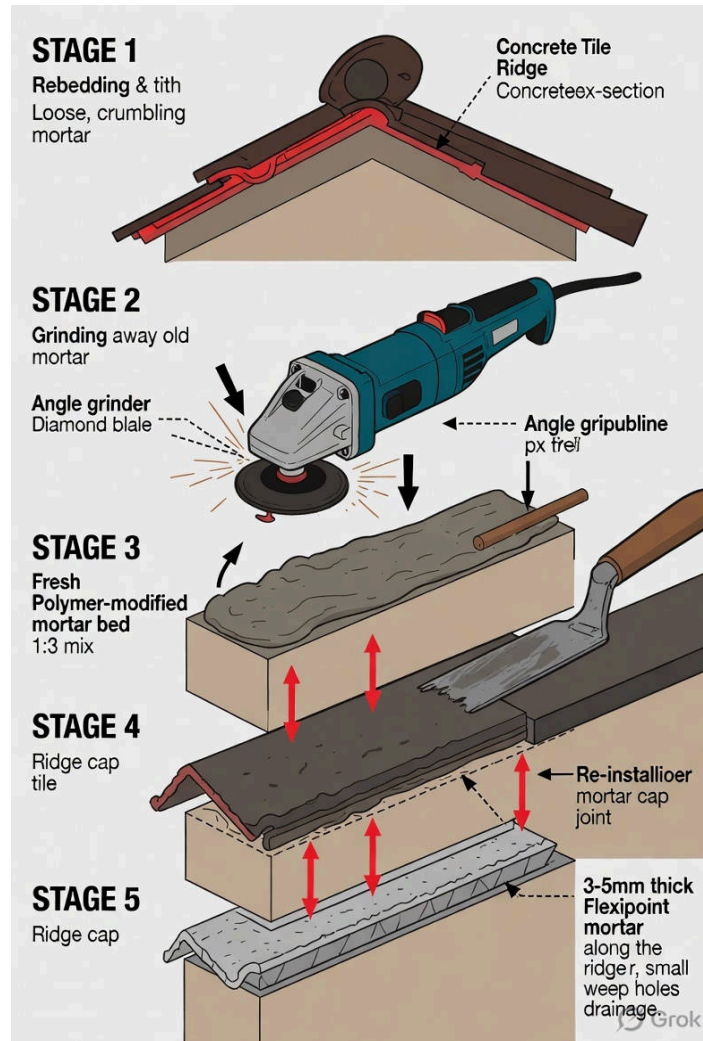


Diagram 2: Showing the Outcome – Before vs After Ridge Repair



Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Establish a clear exclusion zone at ground level. *What could go wrong:* Falls from height leading to injury. *Mitigation:* Certified anchors, full-body harnesses, daily inspections, two-person rule, AI safety checklist, supervisor verification.
2. **Gutter Clearing** – Clear all organic silt, leaf litter, and weeds from the entire gutter system. Install temporary mesh screens over downpipe openings and bag all waste. *What could go wrong:* Debris entering stormwater causing blockages. *Mitigation:* Screens and immediate removal.
3. **Tile Swap Execution** – Locate all slipped, cracked, and fractured tiles. Use tile-lifter to lift overlapping tiles, remove broken ones, inspect battens, slide new matching tiles into position ensuring lugs and water-locks engage. Secure high-wind zones with galvanized clips. *What could go wrong:* New leaks from poor fit. *Mitigation:* Exact warehouse-matched tiles and full engagement check.
4. **Ridge Cap Demolition** – Carefully pry affected capping tiles free (mainly corners where mortar is completely broken) and stack safely on roof-mounted racks. *What could go wrong:* Damage to underlying tiles. *Mitigation:* Controlled prying and protective mats.
5. **Mechanical Grinding** – Grind away old degraded mortar where required (mainly corners) using dust-shrouded grinder connected to HEPA vacuum. *What could go*



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

wrong: Dust exposure or weak bond surface. *Mitigation:* Full suppression and grind to solid substrate.

6. **Mortar Preparation** – Mix high-strength 1:3 sand-cement mortar incorporating SBR latex polymer at manufacturer ratio to semi-dry plastic consistency. *What could go wrong:* Shrinkage cracks. *Mitigation:* Polymer additive and correct mix.
7. **Mortar Bedding & Reinstallation** – Apply consistent mortar bed where required (mainly corners), wet contact surfaces, position caps along high-tension string line, press firmly, trim excess. *What could go wrong:* Misaligned ridge. *Mitigation:* String line guide.
8. **Flexible Pointing Application** – After initial set (12–24 hours), apply full repointing of the whole house with 3–5 mm Flexipoint extending onto pan tiles and form weep holes. *What could go wrong:* Delamination. *Mitigation:* Clean, dry, cured bedding.
9. **Final Inspection & Cleanup** – Brush down tiles, supervisor inspects entire network for pinholes or gaps, full photo evidence. *What could go wrong:* Missed defects. *Mitigation:* Thorough QC.

OPTION 4: High-Pressure Roof & Gutter Clean – \$2,145 including GST (2-year biological regrowth resistance warranty) – Realistic duration: 1 day (2 technicians + 1 supervisor)

Material & Tooling Matrix

- Biodegradable quaternary ammonium biocide treatment
- Physical downpipe isolation sleeves and sediment filter socks
- Tools: Trailer-mounted diesel pressure washer (3500–4000 PSI regulated flow), turbo-nozzle wand, wet-dry industrial vacuum with hose, garden hose, ground barrier walls

Diagram 1: Explaining the Job – High-Pressure Roof Cleaning Process



HolyMess Pty. Ltd.

Website: www.holymessrepairs.com.au

Email: customercare@holymessrepairs.com.au

Licence 32176 VIC

Licence 450570C NSW


ABN: 31 666 327 813

Phone: 03 8583 2640

Mobile: 0485 881 812

19 Chivers Rd, Templestowe VIC 3106

10/238 Edwardes St. Reservoir VIC 3073

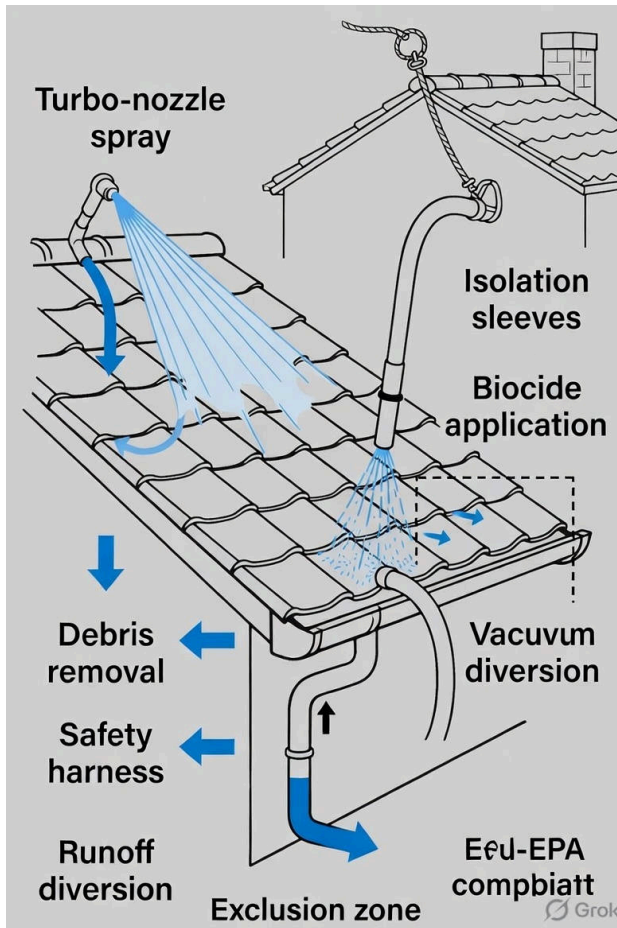



HolyMess Pty. Ltd.

Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Diagram 2: Showing the Outcome – Before vs After Roof Clean



Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Establish a clear exclusion zone at ground level. *What could go wrong:* Falls or slips on wet slippery tiles. *Mitigation:* Certified anchors, full-body harnesses, high-grip roofing boots, short lines, supervisor oversight.
2. **Drainage System Isolation** – Physically disconnect all downpipes and install water-diverting sleeves to direct wash water onto garden turf or filtration sump. *What could go wrong:* EPA violations from silt run-off. *Mitigation:* Full isolation and diversion.
3. **Pre-Inspection** – Inspect entire roof for loose/fractured tiles and replace temporarily with sound tiles. *What could go wrong:* New water ingress during wash. *Mitigation:* Temporary sound tiles.
4. **Equipment Setup** – Set up trailer-mounted pressure washer at regulated 3500–4000 PSI. *What could go wrong:* Equipment malfunction. *Mitigation:* Pre-check and calibrated settings.



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

5. **Directional Washing** – Begin at highest ridge and work systematically downward along natural tile pitch with turbo nozzle at consistent 300–400 mm distance. *What could go wrong:* Water forced under tile laps flooding ceiling. *Mitigation:* Strict downward-only angle.
6. **Biological Growth Stripping & Gutter Flush** – Strip lichen/moss from tile pores, flush gutters, vacuum channels clean. *What could go wrong:* Incomplete cleaning or residual slurry. *Mitigation:* Thorough passes and vacuum removal.
7. **Stormwater Reconnection & Final Cleanup** – Wash down overspray on walls/windows/paths, reconnect downpipes, supervisor QC with photos. *What could go wrong:* Residual mess on site. *Mitigation:* Full site wash and vacuum.

OPTION 5: Comprehensive Structural Repair & Deep Clean Package – \$12,155 including GST (10-year combined structural & watertightness warranty) – Realistic duration: 4–5 working days (2 technicians + 1 full-time supervisor, total ~60 technician hours + 30 supervisor hours including all downtime)

Material & Tooling Matrix

All materials from Options 3 and 4 combined (concrete tiles, polymer mortar, Flexipoint, biocide, sealants, dust-shrouded tools, pressure washer, etc.)

Diagram 1: Explaining the Job – Comprehensive Repair Sequence



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Safety Setup & Clean

- Install safety measures
- Remove debris
- Clean tiles



Tile Swap & Ridge Rebedding/Repainting

(Where Required Mainly Corners)



- Remove damaged tiles
- Install new tiles
- Rebed/repoint ridge tiles



Full Repointing

- Apply mortar
- Point mortar joints
- Clean excess mortar



Grok

Diagram 2: Showing the Outcome – Before vs After Comprehensive Repair



Website: www.holymessrepairs.com.au
 Email: customercare@holymessrepairs.com.au
 Licence 32176 VIC
 Licence 450570C NSW
 ABN: 31 666 327 813
 Phone: 03 8583 2640
 Mobile: 0485 881 812
 19 Chivers Rd, Templestowe VIC 3106
 10/238 Edwardes St. Reservoir VIC 3073



Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Establish a clear exclusion zone at ground level. *What could go wrong:* Falls from height leading to injury. *Mitigation:* Certified anchors, full-body harnesses, daily inspections, two-person rule, AI safety checklist, supervisor verification.
2. **Deep Clean (High-Pressure Roof & Gutter)** – Isolate downpipes, directional downward turbo-nozzle wash, vacuum debris, apply biocide.
3. **Change Broken Tiles + Ridge Rebedding (Where Required, Mainly Corners) & Full Repointing** – Tile swaps with clips, ridge grinding where required (mainly corners), 1:3 polymer mortar rebedding, 3–5 mm Flexipoint full repointing of the whole house, weep holes.
4. **Final QC, Testing & Handover** – Supervisor inspects every joint/seal, post-work verification, full photo/video evidence, site vacuumed spotless.

OPTION 6: Ultimate Premium Whole Roof Restoration – \$22,440 including GST (12-year full-system watertightness & material warranty) – Realistic duration: 10–11 working days (2 technicians + 1 supervisor, total ~110 technician hours + 55 supervisor hours including all downtime)

Material & Tooling Matrix



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

All materials from Option 5 PLUS quaternary ammonium biocide treatment, high-adhesion acrylic primer-sealer (approximately 3 drums), premium elastomeric roof membrane (approximately 6 drums), airless spray unit, spray tips (517 & 521), wet film thickness gauge, digital concrete moisture meter

Diagram 1: Explaining the Job – Full Roof Restoration Layers

Diagram 2: Showing the Outcome – Before vs After Full Restoration

Detailed Step-by-Step Procedure

1. **Site Mobilisation & Safety Setup** – Rig temporary safety anchors to structural points on the roof. Wear full-body safety harness connected to an adjustable static line. Establish a clear exclusion zone at ground level. *What could go wrong:* Falls from height leading to injury. *Mitigation:* Certified anchors, full-body harnesses, daily inspections, two-person rule, AI safety checklist, supervisor verification.
2. **Deep Clean (High-Pressure Roof & Gutter)** – Isolate downpipes, directional downward turbo-nozzle wash, vacuum debris, apply biocide.
3. **Garage Eave Lining Replacement** – Controlled demolition, timber preservation with copper naphthenate, new 4.5 mm FC sheets with PVC H-joints and Sikaflex sealing, priming and painting.
4. **Skylight Perspex Retrofitting** – Harness access, rivet removal, frame cleaning, Perspex cut with 5 mm expansion gap, neutral-cure silicone and EPDM washers.
5. **Change Broken Tiles + Ridge Rebedding (Where Required, Mainly Corners) & Full Repointing** – Tile swaps with clips, ridge grinding where required (mainly corners), polymer mortar, Flexipoint full repointing of the whole house and weep-hole process.
6. **Sterilisation & Moisture Testing** – Spray full biocide, allow complete drying, verify tile moisture content below 10% with digital meter.
7. **High-Adhesion Primer-Sealer Application** – Airless spray one even coat (150–200 µm wet film thickness) with 517 tip.
8. **Elastomeric Membrane Topcoats** – Apply first coat (250–300 µm), allow 4-hour cure, apply second perpendicular coat (total dry film thickness ≥500 µm) with 521 tip under wind <15 km/h.
9. **Final Inspection & Handover** – Full visual audit of all laps/valleys, reconnect downpipes, provide professional drone footage (valued at \$550), client walkthrough with supervisor QC and complete photo/video evidence.

Comprehensive Multi-Dimensional Risk Management (applies to all options)



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Physical safety risks (falls from height, dust inhalation) are mitigated with certified roof anchors, full-body harnesses, P2 respirators, HEPA-vacuum tools, and supervisor oversight. Property damage risks (internal water ingress, tile cracking, chemical/silt contamination) are controlled with downward-only spraying, protective tarps, moisture metering before coatings, and EPA-compliant runoff containment. Financial loss risks (project delays, repeat leaks, liability claims) are prevented by real-time weather scheduling, full Public Liability and WorkCover insurance, written warranties, and photographic proof at every stage.

Industry Ethics & HolyMess Repairs Safeguards

The roof repair industry sometimes sees operators who cut corners by skimming pointing over loose mortar, watering down coatings, skipping primer-sealer, spraying upward under tiles, replacing only visible broken tiles, or disappearing after payment. HolyMess Repairs never does this. We operate under VBA Licence 32176, maintain Victoria's largest network of vetted tradespeople, use agentic AI office support and experienced project managers, and provide full digital transparency with before/after evidence. We can handle any roof type (tile, metal, slate) and any job size or urgency because we are not restricted like single-solution companies.

Why Choose HolyMess Repairs?

- Full ownership of your job from diagnosis to handover
- Largest vetted tradesperson network and agentic AI project management
- Licensed, compliant, insured, and transparent with photographic evidence
- Versatile capability for repairs, restoration, painting, gutters, skylights, and emergency work
- Proven by Google reviews, YouTube testimonials, and our commitment to long-term client outcomes

Next Steps

Please reply with your chosen option(s) or call 0426 204 244. I will text you the day before to confirm a convenient time when you are home. We arrive with all materials from our warehouse (spare matching tiles can be left on-site if you send a photo of your tile profile). Most options or combinations can be completed efficiently in a single mobilisation.

We look forward to delivering a permanent, warrantied, high-quality solution that protects your home for decades to come.

Kind regards,

Victor C

Compliance Manager

HolyMess Repairs



Website: www.holymessrepairs.com.au
Email: customercare@holymessrepairs.com.au
Licence 32176 VIC
Licence 450570C NSW
ABN: 31 666 327 813
Phone: 03 8583 2640
Mobile: 0485 881 812
19 Chivers Rd, Templestowe VIC 3106
10/238 Edwardes St. Reservoir VIC 3073

Licence 32176 | ABN 31 666 327 813

0426 204 244 | info@holymessrepairs.com.au